
HCX5000 System and Custom Update List For Release 730

| <i>Update</i> | <i>Note</i> | <i>Description</i> | <i>Update Type</i> | <i>Processor</i> |
|---------------|-------------|--|--------------------|--------------------|
| | | | <i>CUSTOM</i> | <i>16 BIT</i> |
| 0001 | N/A | Dial 9 for local, operator assisted & no charge type of calls only, 8 can access all types of calls. Works by TOC | | |
| 0002 | N/A | Allow V03 message (check-in with MIF) to VMS when check in from VDU | | Disables PMS port. |
| 0003 | N/A | Separate ringing capability to lines in Hotel Key Group. | | |
| 006R | N/A | Provide station to station access code for 9-LESS dialing. | | |
| 009R | N/A | Allow initial Period (IP) of 90 minutes for type of call billing. | | |
| | | | <i>CUSTOM</i> | <i>16/32</i> |
| 9011 | N/A | PMS Hobic format changes: Sequence number expanded to 4 digits, type of call is now fixed location, STX/ETX/BCC replaced by CR/LF, Sequence number is now reset daily to either 1 or 5001 (alternating). On reboot, seq # is set appropriately to time of day. | | |
| 9012 | N/A | Assert additional period charge only once for calls | | |
| | | | <i>CUSTOM</i> | <i>32 BIT</i> |
| 0003 | N/A | Separate ringing capability to lines in Hotel Key Group. | | |
| 0007 | N/A | Provides Maid ID for room status. | | |
| 009R | N/A | Allow initial Period (IP) of 90 minutes for type of call billing. | | |

Note 1: This update uses an overlay area which may cause the system to become unstable when some CMAT screens are accessed prior to reload.

Note 2: This update modifies the customer data area. RCD must not be performed after this patch is applied until the system is reloaded.

Note 3: This update was determined to be deficient after it was released. Please check for a later update to supplement this one.

| <i>Update</i> | <i>Note</i> | <i>Description</i> | <i>Update Type</i> | <i>Processor</i> |
|---------------|-------------|--|--------------------|------------------|
| | | | <i>SYSTEM</i> | <i>16/32</i> |
| 0001 | N/A | Check the version up system class bit only if the system is off line. | | |
| 0002 | N/A | The attendant is unable to transfer an incoming call to a Hotel Group (HGF) if the pilot is busy. | | |
| 0003 | N/A | Provide a Call Waiting Cover to VMS feature for PRI trunk call (Part 1 of 6) | | |
| 0004 | N/A | Provide a Call Waiting Cover to VMS feature for PRI trunk call (Part 2 of 6) | | |
| 0005 | N/A | Provide a Call Waiting Cover to VMS feature for PRI trunk call (Part 3 of 6) | | |
| 0006 | N/A | Provide a Call Waiting Cover to VMS feature for PRI trunk call (Part 4 of 6) | | |
| 0007 | N/A | Provide a Call Waiting Cover to VMS feature for PRI trunk call (Part 5 of 6) | | |
| 0008 | N/A | Provide a Call Waiting Cover to VMS feature for PRI trunk call (Part 6 of 6) | | |
| 0009 | N/A | Prevents the system from reset when the Hotel Group Feature (HGF) is turned off & the system is currently loaded. | | |
| 0010 | N/A | Allow task trace for specified LPNs. | | |
| 0011 | N/A | The AP commnad TRAC:DSP will no longer require the system class bit of Caller ID to be on in order to execute. | | |
| 0012 | N/A | The attendant E911 alarm key will not extinguish when calls are placed by stations that are not assigned in Screen 2.1.9.1.21. | | |
| 0013 | N/A | Push Button Senders (PBS) lock up when Call Waiting to Cover bit is set in BCL. | | |
| 0014 | N/A | Provide answer supervision for PRI calls to ACD announcements. | | |
| 0015 | N/A | Allow #'s & *'s as valid input on CMAT Screen 2.1.9.4.12 (Mate DN/Mate MDN field). | | |
| 0016 | N/A | Answer Detection checks route data incorrectly. | | |
| 0017 | N/A | Can't external call cover/forward to WATS, FXT & LDT. | | |
| 0018 | N/A | Recall to attendant for PRI trunk call may reset system in some cases. | | |
| 0019 | N/A | Allow clearer messages when running multiple V&H floppies. | | |
| 0020 | N/A | Allow FTN satellite calls to be transferred back to main. | | |
| 0021 | N/A | ISDN trunks calls will not ring. | | |
| 0022 | N/A | Allow correct processing of Fault Analysis UVMS & clearing of VMS & PMS message buffer. | | |
| 0023 | N/A | Call to a station will not cover to the external UVMS number. | | |
| 0024 | N/A | Provide station greeting for PRI calls that go to voice mail (VM). | | |
| 0025 | N/A | Allow wake up confirmation announcement for SelectSets. | | |
| 0026 | N/A | SelectSet may not ring after multiple trunk calls have been tranferred to it. | | |
| 0027 | N/A | Corrects 2 problems - 1. No ringing or incorrect ringing pattern for 2500 sets. 2. Incorrect ring patterns on MFT. | | |
| 0028 | N/A | SelectSet 700 cap lamp continues to flash for a call in progress. | | |
| 0029 | N/A | Abnormally short & long MW messages can cause system reset with fault ID#19.. | | |
| 0030 | N/A | Caller ID transfer may corrupt ringing patten. | | |

Note 1: This update uses an overlay area which may cause the system to become unstable when some CMAT screens are accessed prior to reload.

Note 2: This update modifies the customer data area. RCD must not be performed after this patch is applied until the system is reloaded.

Note 3: This update was determined to be deficient after it was released. Please check for a later update to supplement this one.

| <i>Update</i> | <i>Note</i> | <i>Description</i> | <i>Update Type</i> | <i>Processor</i> |
|---------------|-------------|---|--------------------|------------------|
| 0031 | N/A | Prevents PRI call on hold at Fictitious Line from going to coverage point. | | |
| 0032 | N/A | Prevents incorrect entries from being added to the vector table upon boot up. | | |
| 0033 | N/A | Automatic Call Return may go to intercept tone incorrectly if a call is made from a DID trunk. | | |
| 0034 | N/A | Allow edit of CMAT Screen 2.1.7.5.4. | | |
| 0035 | N/A | When VMS alarm is on for MFT and incoming call is transferring to VMS, system may reset. | | |
| 0036 | N/A | Incoming PRI call to attendant Listed Directory Number (LDN) does not get Ring Back Tone (RBT). | | |
| 0037 | N/A | Incoming PRI call to a busy 2500 with CID CW enabled but no device may cause system restart. | | |
| 0038 | N/A | Correct output displayed from PLD:BCLD AP command. | | |
| 0039 | N/A | DID call ringing pattern is incorrect for 2500 set. | | |
| 0040 | N/A | Remove progress status indicator from alert message. | | |
| 0041 | N/A | After TAFAS is used to pick up a number of recalls, Automatic Recall may not work. | | |
| 0042 | N/A | Allow MW cancel for FTN UVMS & VMS | | |
| 0043 | N/A | Call waiting cover to VMS llocks up voice mail port when VMS is out of service | | |
| 0044 | N/A | MW lamp does not go out when returning a call me to a station. This does not apply to voice mail. | | |
| 0045 | N/A | Allow correct recognition & charges of Carribbean NPAs. | | |
| 0046 | N/A | When VMS line is busy & cover no answer timer is expired, system may reset. | | |
| 0047 | 1 | Allow key group autodial keys for member stations to version up. | | |
| 0048 | N/A | Attendant continues to ring with two calls showing in cue when no calls are actually present and can not be answered. | | |
| 0049 | N/A | Last Number Redial (LNR) for station contains incorrect data. | | |
| 0050 | N/A | Change version up to include ACD Queue Threshold Data. | | |
| 0051 | N/A | Initialize message waiting flag to yes on version up. | | |
| 0052 | N/A | When a PRI call terminates to a SelectSet 700 (ringing state) & is answered, the trunk text is displayed causing Caller ID malfunction. | | |
| 0053 | N/A | Corrects version up error for code calling data. | | |
| 0054 | N/A | DID calls after ring no answer timeout may not cover to voice mail or may cause the system to reset. | | |
| 0055 | N/A | Correct PRI L3 protocol error #4 after release complete. | | |
| 0056 | N/A | Station TOS doesn't follow authorization code TOS over FTN. | | |
| 0057 | N/A | Deletion of a key group member causes the group hold lamp not to light. | | |
| 0058 | N/A | FTN lock-up when trunk disconnects during recall from satellite. | | |
| 0059 | N/A | Fix PMS lock-up when sending voice message notification (MSG2) to PMS. | | |
| 0060 | N/A | Address Y2K report issues (Part 1 of 3) | | |
| 0061 | N/A | Address Y2K report issues (Part 2 of 3) | | |
| 0062 | N/A | Terminal memory corruption may cause system to reload with fault ID#19 | | |

Note 1: This update uses an overlay area which may cause the system to become unstable when some CMAT screens are accessed prior to reload.

Note 2: This update modifies the customer data area. RCD must not be performed after this patch is applied until the system is reloaded.

Note 3: This update was determined to be deficient after it was released. Please check for a later update to supplement this one.

| <i>Update</i> | <i>Note</i> | <i>Description</i> | <i>Update Type</i> | <i>Processor</i> |
|---------------|-------------|--|--------------------|------------------|
| 0063 | N/A | Address Y2K report issues (Part 3 of 3) | | |
| 0064 | N/A | Disable the MDR:CPY command & Fix Flex Room Suite message STE4 so it clears directory names. | | |
| 0065 | N/A | Fix SPM shelf lock up due to adnormal PRI condition. | | |
| 0066 | N/A | Fix Occupancy report & erroneous deletion of call records. | | |
| 0067 | N/A | Corrects 2 problems - 1. Call records will not appear in reports after year 2000. 2. Admin. call charges can't be erased manually. | | |
| 0068 | N/A | Duplicate call reference value calculated when PRI associated D-channel is used causing call origination failures & disconnects.. | | |
| 0069 | N/A | Invalid PRI L3 restart message processing to idle specific B-channel. | | |
| 0070 | N/A | When several ACD intraflow calls activate the LTA on attendant, system could reset with fault ID#19. | | |
| 0071 | N/A | Zone translation was not including the charge for initial/additional periods on intralata calls. | | |
| 0072 | N/A | Fixes no response condition for variable/remote CMAT. | | |
| 0073 | N/A | Unable to make outgoing calls via PRI to Northern Switch, sending wrong progress indicator | | |
| 0074 | N/A | Time Slot TS lock up by call waiting caller ID in module groups greater then 0. | | |
| 0075 | N/A | Correct mailbox assignments for guest rooms if message center is not enabled. | | |
| 0076 | 3 | PRI BCH Status change OOS to IS in case of incoming call part 1 | | |
| 0077 | N/A | Correct text on screen 4.1.4.7.1. for phase 113 "Clear Call/ACCT/CID Recs" | | |
| 0078 | N/A | Correct sequence for retrieving trunk hunt timer data | | |
| 0079 | N/A | Fix PRI ACD call disconnect after ringing timeout | | |
| 0080 | 3 | PRI BCH Status change OOS to IS in case of incoming call part 2 | | |
| 0081 | N/A | Fix ACD Traffic Save Buffer | | |
| 0082 | N/A | Allow HGF for PRI call | | |
| 0083 | N/A | Allow VMS overflow when VMS is out of service (VMS type is AOK) | | |
| 0084 | N/A | Fix caller ID mismatch for redirected call | | |
| 0085 | N/A | "ALL" PRI BCH status change OOS to INS in case of incoming call | | |
| 0086 | N/A | FLTID=1 System error when receiving minimum length ISDN frame | | |
| 0087 | N/A | Correct "DIAL IN PATTERN LIST" JOB DRAW to output DID and TIE | | |
| 0088 | N/A | HOBIC/HOBIS input call records can be sent out the PMSHOBIC port, but dialed digits field is blank. | | |
| 0089 | N/A | Fix FLTID = 1 by wrong input | | |
| 0090 | N/A | Correct auto key corruption on pattern mismatch | | |
| 0091 | N/A | Fix PRI L3 protocol error for invalid coding standard in disconnect message | | |
| 0092 | N/A | Fix PRI L3 protocol error (cause 96) due to improper disconnect sequence | | |
| 0093 | N/A | Fix occasional problem deleting remote maintenance center in CMAT screen 6.1 | | |
| 0094 | N/A | Correct TGN traffic report incoming talk average calculation | | |

Note 1: This update uses an overlay area which may cause the system to become unstable when some CMAT screens are accessed prior to reload.

Note 2: This update modifies the customer data area. RCD must not be performed after this patch is applied until the system is reloaded.

Note 3: This update was determined to be deficient after it was released. Please check for a later update to supplement this one.

| <i>Update</i> | <i>Note</i> | <i>Description</i> | <i>Update Type</i> | <i>Processor</i> |
|---------------|-------------|--|--------------------|------------------|
| 0095 | N/A | Fix error restart when automatic callback is interrupted by new call | | |
| 0096 | N/A | Quiet the squeal on some T1 connections / transfers | | |
| 0097 | N/A | Fix intermittent timer degradation | | |
| 0098 | N/A | Correct DID error checking on station cancellation | | |
| 0099 | N/A | Prevent system crash after direct trunk access switch hook flash | | |

Note 1: This update uses an overlay area which may cause the system to become unstable when some CMAT screens are accessed prior to reload.

Note 2: This update modifies the customer data area. RCD must not be performed after this patch is applied until the system is reloaded.

Note 3: This update was determined to be deficient after it was released. Please check for a later update to supplement this one.