
HCX5000 System and Custom Update List For Release 740

<i>Update</i>	<i>Note</i>	<i>Description</i>	<i>Update Type</i>	<i>Processor</i>
			<i>CUSTOM</i>	<i>16 BIT</i>
0001	N/A	Dial 9 for local, operator assisted & no charge type of calls only, 8 can access all types of calls. Works by TOC		
0003	N/A	Allow ringing for station status of 00, similar to the station with status 1.		
0005	N/A	Main listed number is sent over PRI trunks for E911 calls.		
002R	N/A	Allow initial Period (IP) of 90 minutes for type of call billing.		
			<i>CUSTOM</i>	<i>16/32</i>
0010	N/A	PMSHOBIC format changes (4 Digit sequence numbers, set TOC to fixed position).		
			<i>CUSTOM</i>	<i>32 BIT</i>
0003	N/A	Allow ringing for station status of 00, similar to the station with status 1.		
0005	N/A	Main listed number is sent over PRI trunks for E911 calls.		
0006	N/A	Prevent PRI protocol errors based on Siemens NI2 ISDN protocol.		
0007	N/A	Changes calling party number to forwarding party for billing purposes on PRI turnk to trunk call.		
0008	N/A	Remove 101XXXX+1/011 & 10XXX+1/011 restrictions. (Calls are routed to MPN 17, TOC is NOCHG)		
0009	N/A	Expand internal/external hotline to 127 entries (Note: This has special update procedures).		
002R	N/A	Allow initial Period (IP) of 90 minutes for type of call billing.		

Note 1: This update uses an overlay area which may cause the system to become unstable when some CMAT screens are accessed prior to reload.

Note 2: This update modifies the customer data area. RCD must not be performed after this patch is applied until the system is reloaded.

Note 3: This update was determined to be deficient after it was released. Please check for a later update to supplement this one.

<i>Update</i>	<i>Note</i>	<i>Description</i>	<i>Update Type</i>	<i>Processor</i>
			<i>SYSTEM</i>	<i>16/32</i>
0001	N/A	Correct V&H six digit translation problems.		
0002	N/A	Size fix for error message 040568.		
0003	N/A	Correct MSGSIZE for correction calculation of DN digits.		
0004	N/A	When a PRI call terminates to a SelectSet 700 (ringing state) & is answered, the trunk text is displayed causing Caller ID malfunction.		
0005	N/A	Can't assign "1000" (BLF Only) pattern to key group member autokey.		
0006	N/A	Attendant continues to ring with two calls showing in cue when no calls are actually present and can not be answered.		
0007	N/A	Version up of key group data receives 040569 error incorrectly.		
0008	N/A	Remote CMAT does not disconnect & Variable CMAT will not longer allow CMAT access.		
0009	N/A	Last Number Redial (LNR) for station contains incorrect data.		
0010	N/A	ACD call queue not working properly. (32 BIT Only)		
0011	N/A	Correct Caller ID (Name/Number mismatch) for covered/forwarded CO calls.		
0012	N/A	Change version up to include ACD Queue Threshold Data.		
0013	N/A	When PMSHOBIC times out, the port locks up and will not retry & also OS timers overriding PMSHOBIC		
0014	N/A	Clears attendant ringing & answer key for recall picked up via TAFAS.		
0015	N/A	Update display after facility message received.		
0016	N/A	When entering a SAD entry for a key group member of the same group on CMAT Screen 2.1.9.4.14, sometimes data will set incorrectly.		
0017	N/A	Initialize message waiting flag to yes on version up.		
0018	N/A	Under heavy load, system may reset when receiving PRI calling name facility message.		
0019	N/A	Corrects version up error for code calling data.		
0020	N/A	Correct PRI L3 protocol error #4 after release complete.		
0021	N/A	Variable CMAT locks up if disconnected during SYSMSG session.		
0022	N/A	Take out group ringing feature for all selectset Hotel Group.		
0023	N/A	Allow call waiting cover to VMS from DID to 2500 sets.		
0024	N/A	Station TOS doesn't follow authorization code TOS over FTN.		
0025	N/A	Lock-up of the pilot MFT station of Hotel Group (HG).		
0026	N/A	Fix SMDR output format for 4 digit year field to include LF/CR.		
0027	N/A	Deletion of a key group member causes the group hold lamp not to light.		
0028	N/A	Provides CAN/Recall for incoming trunk calls without Terminating On-Hook Signal set to "yes".		
0029	N/A	Accessing illegal terminal memory may cause system to reset with fault ID#19.		
0030	N/A	PRI calls picked up from attendant delay announcement, gets one-way speech path.		

Note 1: This update uses an overlay area which may cause the system to become unstable when some CMAT screens are accessed prior to reload.

Note 2: This update modifies the customer data area. RCD must not be performed after this patch is applied until the system is reloaded.

Note 3: This update was determined to be deficient after it was released. Please check for a later update to supplement this one.

<i>Update</i>	<i>Note</i>	<i>Description</i>	<i>Update Type</i>	<i>Processor</i>
0031	N/A	Can't access VDU to enter call charges if a CI system has no message center.		
0032	N/A	Fix PMS lock-up when sending voice message notification (MSG2) to PMS.		
0033	N/A	Automatic Call Return (ACR) does not work for local PRI calls.		
0034	N/A	Address Y2K report issues (Part 1 of 3)		
0035	N/A	Address Y2K report issues (Part 2 of 3)		
0036	N/A	Type of call check for incoming PRI permissive dial, NPA/remove "9" before Caller ID.		
0037	N/A	FTN lock-up when trunk disconnects during recall from satellite.		
0038	N/A	Address Y2K report issues (Part 3 of 3)		
0039	N/A	Disable the MDR:CPY command & Fix Flex Room Suite message STE4 so it clears directory names.		
0040	N/A	Variable CMAT sometime does not allow the user to select a value 1 or 2 on the 1st decision menu.		
0041	N/A	Fix SPM shelf lock up due to adnormal PRI condition.		
0042	N/A	Incoming PRI call will not cover after no answer timer expires when coverage point is across FTN.		
0043	N/A	Fix Occupancy report & erroneous deletion of call records.		
0044	N/A	Corrects 2 problems - 1. Call records will not appear in reports after year 2000. 2. Admin. call charges can't be erased manually.		
0045	N/A	Duplicate call reference value calculated when PRI associated D-channel is used causing call origination failures & disconnects..		
0046	N/A	When duplicate PAT ADDR commands are issued, it may disrupt the patch disk command.		
0047	N/A	Invalid PRI L3 restart message processing to idle specific B-channel.		
0048	N/A	Prevent possible reset when exceeding 2048 key group members. (32 BIT Only)		
0049	N/A	Outgoing PRI call placed on Soft Park can't be picked up.		
0050	N/A	HOBIC/HOBIS input call records can be sent out the PMSHOBIC port, but dialed digits field is blank.		
0051	N/A	When several ACD intraflow calls activate the LTA on attendant, system could reset with fault ID#19.		
0052	N/A	Zone translation was not including the charge for initial/additional periods on intralata calls.		
0053	N/A	If a station is cover no answer to the attendant and the system is in night mode, it will not cover.		
0054	N/A	Correct initialization of power failure trunk data.		
0055	N/A	Chronological reports misses calls originating at 23:59.		
0056	N/A	PRI duplicates call references when using IDS 2 & 3 when using unassociated D channel.		
0057	N/A	Wrong tax is calculated for international calls.		
0058	N/A	Prevents HCX from sending status message over PRI when CO sends facility message during talk state.		
0059	N/A	ISDN message trace tool.		
0060	N/A	Prevent L3 protocol errors due to progress indicator IE in alert message on tandem PRI calls.		
0061	N/A	Prevent L3 protocol errors when sending "A" cause value in disconnect message.		
0062	N/A	L3 protocol error occurs after receiving notify message with a value of F1.		

Note 1: This update uses an overlay area which may cause the system to become unstable when some CMAT screens are accessed prior to reload.

Note 2: This update modifies the customer data area. RCD must not be performed after this patch is applied until the system is reloaded.

Note 3: This update was determined to be deficient after it was released. Please check for a later update to supplement this one.

<i>Update</i>	<i>Note</i>	<i>Description</i>	<i>Update Type</i>	<i>Processor</i>
0063	N/A	Fixes no response condition for variable/remote CMAT.		
0064	N/A	Allow past holiday cancellation in Screen 2.1.7.1		
0065	N/A	Station Caller ID pickup is lost on PRI incoming call.		
0066	N/A	Allows exception reports of special numbers to have up to 6 digit numbers.		
0067	N/A	Allows Caller ID pickup when call name SYSCLS is off.		
0068	N/A	Connect the ACD announcement trunk when HCX received start message for PRI.		
0069	N/A	No answer supervision on attendant delay announcement prior to start signal.		
0070	N/A	One way speech on a PRI call cover to all to 2nd station.		
0071	N/A	Unable to make outgoing calls via PRI to Northern Switch, sending wrong progress indicator		
0072	N/A	Time Slot TS lock up by call waiting caller ID in module groups greater then 0.		
0073	N/A	Correct mailbox assignments for guest rooms if message center is not enabled.		
0074	N/A	Tie line to 5 digit station goes to attendant.		
0075	3	PRI BCH Status change OOS to IS in case of incoming call part 1		
0076	N/A	Correct text on screen 4.1.4.7.1. for phase 113 "Clear Call/ACCT/CID Recs"		
0077	N/A	Correct sequence for retrieving trunk hunt timer data		
0078	N/A	Fix PRI ACD call disconnect after ringing timeout		
0079	3	PRI BCH Status change OOS to IS in case of incoming call part 2		
0080	N/A	Fix ACD Traffic Save Buffer		
0081	N/A	Allow ATT recall for PRI tandem call through CO, FTN, PRI		
0082	N/A	Allow VMS overflow when VMS is out of service (VMS type is AOK)		
0083	N/A	Fix calling name mismatch for redirected call		
0084	N/A	"ALL" PRI BCH status change OOS to INS in case of incoming call		
0085	N/A	FLTID=1 System error when receiving minimum length ISDN frame		
0086	N/A	Correct "DIAL IN PATTERN LIST" JOB DRAW to output DID and TIE		
0087	N/A	HOBIC/HOBIS input call records can be sent out the PMSHOBIC port, but dialed digits field is blank.		
0088	N/A	Fix FLTID = 1 by wrong input		
0089	N/A	Change number display from 10 digits to station number for internal call to analog CID stations for non-residential systems.		
0090	N/A	Fix TS lockup with PRI call waiting - Attendant Lockup Possibility		
0091	N/A	Free memory allocation after remote access		
0092	N/A	Correct auto key corruption on pattern mismatch		
0093	N/A	Department report misses some stations		
0094	N/A	Fix intermittent timer degradation		

Note 1: This update uses an overlay area which may cause the system to become unstable when some CMAT screens are accessed prior to reload.

Note 2: This update modifies the customer data area. RCD must not be performed after this patch is applied until the system is reloaded.

Note 3: This update was determined to be deficient after it was released. Please check for a later update to supplement this one.

<i>Update</i>	<i>Note</i>	<i>Description</i>	<i>Update Type</i>	<i>Processor</i>
0095	N/A	Fix PRI L3 protocol error for invalid coding standard in disconnect message		
0096	N/A	Fix PRI L3 protocol error (cause 96) due to improper disconnect sequence		
0097	N/A	Fix occasional problem deleting remote maintenance center in CMAT screen 6.1		
0098	N/A	Fix variable CMAT 1/2 decision menu error		
0099	N/A	Correct TGN traffic report incoming talk average calculation		
0100	N/A	Fix error restart when automatic callback is interrupted by new call		
0101	N/A	Quiet the squeal on some T1 connections / transfers		
0102	N/A	Correct DID error checking on station cancellation		
0103	N/A	Prevent system crash after direct trunk access switch hook flash		

Note 1: This update uses an overlay area which may cause the system to become unstable when some CMAT screens are accessed prior to reload.

Note 2: This update modifies the customer data area. RCD must not be performed after this patch is applied until the system is reloaded.

Note 3: This update was determined to be deficient after it was released. Please check for a later update to supplement this one.