
HCX5000 System and Custom Update List For Release 800

<i>Update</i>	<i>Note</i>	<i>Description</i>	<i>Update Type</i>	<i>Processor</i>
			<i>CUSTOM</i>	<i>16 BIT</i>
0001	N/A	Dial 9 for local, operator assisted & no charge type of calls only, 8 can access all types of calls. Works by TOC		
0002	N/A	Add "A" to PMSHOBIC output for operator assisted calls.		
0009	N/A	PMS Hobic format changes: Sequence number expanded to 4 digits, type of call is now fixed location, STX/ETX/BCC replaced by CR/LF, Sequence number is now reset daily to either 1 or 5001 (alternating). On reboot, seq # is set appropriately to time of day.		
9023	N/A	Assert additional period charge only once for calls	<i>CUSTOM</i>	<i>16/32</i>
0004	N/A	Changed PMSHOBIC output to match HOBIC Merge Format.	<i>CUSTOM</i>	<i>32 BIT</i>
0003	N/A	Allow STE4 (dissolve suite) message to process with WU, DND, or MW set.		
0006	N/A	Expand internal/external hotline to 127 entries (Note: This has special update procedures).		
9023	N/A	Assert additional period charge only once for calls		

Note 1: This update uses an overlay area which may cause the system to become unstable when some CMAT screens are accessed prior to reload.

Note 2: This update modifies the customer data area. RCD must not be performed after this patch is applied until the system is reloaded.

Note 3: This update was determined to be deficient after it was released. Please check for a later update to supplement this one.

<i>Update</i>	<i>Note</i>	<i>Description</i>	<i>Update Type</i>	<i>Processor</i>
			<i>SYSTEM</i>	<i>16/32</i>
0001	N/A	If system is in the night mode, attendant calls do not go to the assigned night attendant station.		
0002	N/A	Correct problem with 700 sets answering and placing calls on hold due to incorrect terminal memory address.		
0003	N/A	After backing up floppies, the CMAT screen doesn't display that it was successfully completed.		
0004	N/A	`		
0005	N/A	Zone translation was not including the charge for initial/additional periods on intralata calls.		
0006	N/A	Screen 2.1.5.1 shows trunk text in the wrong place after selecting a TGN.		
0007	N/A	When several ACD intraflow calls activate the LTA on attendant, system could reset with fault ID#19.		
0008	N/A	When the attendant intraflow point to VMS times out, the ports lock-up for internal & external calls		
0009	N/A	The autosave utility to back up pertinent data is the wrong location & size.		
0010	N/A	Version-up from 7.4 turns off default values for #328-PRI calling name & #329-Enhanced AP error text.		
0011	N/A	Correct initialization of power failure trunk data.		
0012	N/A	Allow user to go from screen 2.1.9.4.5A to 2.1.9.4.5. on blank send.		
0013	N/A	If Custom Update #3 is applied, & suite group is broken up, wakeups are cancelled but the wrong station # is printed on the FOA.		
0014	1	Call Block Registration for CMAT allows 8 or 9 digit numbers to be entered, should be 7 or 10 digit.		
0015	N/A	F10 help function key displays "serious system error" message instead of "can not execute this function".		
0016	N/A	Chronological reports misses calls originating at 23:59.		
0017	N/A	FOA output formatting cuts off digits when using HOBIS.		
0018	N/A	Dialing 9-less station to station access code with a invalid station # causes system to reset.		
0019	N/A	When calling into the switch thru a DISA trunk the system could reset.		
0020	N/A	The TAFAS lamp will not turn off when a TAFAS call is answered.		
0021	N/A	PRI duplicates call references when using IDS 2 & 3 when using unassociated D channel.		
0022	N/A	Prevent attendant intraflow to VMS from locking up PBS.		
0023	N/A	System could lock-up with remote dial in using RMAT & high level master passcodes.		
0024	N/A	When an attendant Ringing No Answer (RNA) timer expires, the system could reset		
0025	N/A	Allow internal call from 2500 station to follow attendant intraflow.		
0026	N/A	Wrong tax is calculated for international calls.		
0027	N/A	Prevents HCX from sending status message over PRI when CO sends facility message during talk state.		
0028	N/A	Call Park pickup after transfer causes system restart.		
0029	N/A	Remove 'A' from PMSHOBIC output for operator assisted calls.		
0030	N/A	Group pick-up doesn't work for auto key.		
0031	N/A	Calling in over PRI does not ring phones or cover to VMS		

Note 1: This update uses an overlay area which may cause the system to become unstable when some CMAT screens are accessed prior to reload.

Note 2: This update modifies the customer data area. RCD must not be performed after this patch is applied until the system is reloaded.

Note 3: This update was determined to be deficient after it was released. Please check for a later update to supplement this one.

<i>Update</i>	<i>Note</i>	<i>Description</i>	<i>Update Type</i>	<i>Processor</i>
0032	N/A	Fixes system restart due to ACD recalling the attendant. Part 1 must apply SP#33 also.		
0033	N/A	Error restart when cover to attendant from an ACD group, related to SP#32.		
0034	N/A	Incorrect calling name display for PRI to FTN tandem connection.		
0035	N/A	Prevent L3 Protocol errors due to progress indicator IE in alert message on tandem PRI calls.		
0036	N/A	Prevent L3 Protocol errors when sending "A" cause value in disconnect message.		
0037	N/A	L3 Protocol error occurs after receiving notify message when a value of F1.		
0038	N/A	Can't make calls across FTN from remote site with coverage.		
0039	N/A	Fixes no response condition for variable/remote CMAT.		
0040	N/A	ISDN message trace tool.		
0041	N/A	Message center erase writes to non existant queue.		
0042	N/A	Can't make calls across FTN from remote site.		
0043	N/A	Fix speech path problem associated with update 40.		
0044	N/A	Allows busy station with call-waiting to VMS to go to its mailbox.		
0045	N/A	Caller disconnected after transfer from the busy 2500 station.		
0046	N/A	Repeat wake-up causes IOC port lock up.		
0047	N/A	Internal error log when a PRI call is covered to CAS attendant (FTN).		
0048	N/A	Internal error logged after trunk recall is transferred across FTN and recalls again.		
0049	N/A	Internal error log when a CO call across FTN to station which is covered across FTN to CAS attendant.		
0050	N/A	Allow past holiday cancellation in Screen 2.1.7.1		
0051	N/A	Prevents system restart when using Call Me Return with Hotel Group Feature (HGF).		
0052	N/A	Allows exception reports of special numbers to have up to 6 digit numbers.		
0053	N/A	Fix ACD status display problem on supervisor console.		
0054	N/A	Fix memory deallocation problem with check in using integrity flag.		
0055	N/A	Can not delete DID number with leading zeroes in screen 2.1.9.1.21.		
0056	N/A	Fixes problem with messages to VMS with integrity on.		
0057	N/A	Connect the ACD announcement trunk when HCX received start message for PRI.		
0058	N/A	No answer supervision on attendant delay announcement prior to start signal.		
0059	N/A	Prevents remote coverage cancel from causing system restart.		
0060	N/A	PMS Hobic alarm will not light if link is down.		
0061	N/A	One way speech on a PRI call cover to all to 2nd station.		
0062	N/A	TAFAS Key still lights after key reassigned.		
0063	N/A	Unable to make outgoing calls via PRI to Northern Switch, sending wrong progress indicator		
0064	N/A	Station status display is blank when call is forwarded to another station.		

Note 1: This update uses an overlay area which may cause the system to become unstable when some CMAT screens are accessed prior to reload.

Note 2: This update modifies the customer data area. RCD must not be performed after this patch is applied until the system is reloaded.

Note 3: This update was determined to be deficient after it was released. Please check for a later update to supplement this one.

<i>Update</i>	<i>Note</i>	<i>Description</i>	<i>Update Type</i>	<i>Processor</i>
0065	N/A	PRI incoming call record does not record caller ID		
0066	N/A	DND Forwarding to VMS will not hunt		
0067	N/A	Incoming PRI calls to the attendant and transferred to any station do not record caller ID. Add extra space on FOA printer to line up reports.		
0068	N/A	Fixes version up for screen 2.1.9.4.42 station to DID assignment for caller ID.		
0069	N/A	Time Slot TS lock up by call waiting caller ID in module groups greater then 0.		
0070	N/A	Skip internal FTN (CCS) connection test request message. Under some conditions a system restart may occur when FTN is installed.		
0071	N/A	Correct mailbox assignments for guest rooms if message center is not enabled.		
0072	N/A	Trunk calls that are covered to the attendant during system night mode do not cover to the SNT station.		
0073	N/A	Fix PRI ACD call disconnect after ringing timeout		
0074	N/A	Tie line to 5 digit station goes to attendant.		
0075	3	PRI BCH Status change OOS to IS in case of incoming call part 1		
0076	N/A	Correct text on screen 4.1.4.7.1. for phase 113 "Clear Call/ACCT/CID Recs"		
0077	N/A	Correct sequence for retrieving trunk hunt timer data		
0078	N/A	Correct terminal memory index for CTI part 1		
0079	N/A	Correct terminal memory index for CTI part 2		
0080	3	PRI BCH Status change OOS to IS in case of incoming call part 2		
0081	N/A	Lowers burst ring level for key group ring monitor while on another call		
0082	N/A	Fix ACD traffic save buffer		
0083	N/A	Allow ATT recall for PRI tandem call through CO, FTN, PRI		
0084	N/A	Prevent system restart when using CCS job draw		
0085	N/A	FLTID=1 System error when receiving minimum length ISDN frame		
0086	N/A	FLTID=19 error restart because of double return		
0087	N/A	FLTID=12 error restart can occur with CAS feature		
0088	N/A	Fix E911 alarm on ATT to display station number		
0089	3	Expand number of available processes to 105		
0090	N/A	Allow VMS overflow when VMS is out of service (VMS type is AOK)		
0091	N/A	Correct checkout report to include call records in memory		
0092	N/A	"ALL" PRI BCH status change OOS to INS in case of incoming call		
0093	N/A	Correct SP0089 (16 bit only)		
0094	N/A	Wrong digits sent to VMS after cover all / transfer		
0095	N/A	Fix caller ID mismatch for redirected call		
0096	N/A	Correct "DIAL IN PATTERN LIST" JOB DRAW to output DID and TIE		

Note 1: This update uses an overlay area which may cause the system to become unstable when some CMAT screens are accessed prior to reload.

Note 2: This update modifies the customer data area. RCD must not be performed after this patch is applied until the system is reloaded.

Note 3: This update was determined to be deficient after it was released. Please check for a later update to supplement this one.

<i>Update</i>	<i>Note</i>	<i>Description</i>	<i>Update Type</i>	<i>Processor</i>
0097	N/A	Fix FLTID = 1 by wrong input		
0098	N/A	Change number display from 10 digits to station number for an internal call		
0099	N/A	Fix TS lockup and PRI trunk idle chain problem		
0100	N/A	Free memory allocation after remote access		
0101	N/A	Correct auto key corruption on pattern mismatch		
0102	N/A	Department report misses some stations		
0103	N/A	Fix variable CMAT F1 error		
0104	N/A	Fix intermittent failure when backing up floppies		
0105	N/A	Attendant intraflow cover busy to VMS not sending digits		
0106	N/A	Attendant intraflow station does not cover no answer to VMS		
0107	N/A	Fix PRI L3 protocol error for invalid coding standard in disconnect message		
0108	N/A	Fix PRI L3 protocol error (Cause 96) due to improper disconnect sequence		
0109	N/A	Fix memory de-allocation error in PMS "STE" messages		
0110	N/A	Fix problem deleting remote maintenance center (CMAT screen 6.1)		
0111	N/A	Fix variable CMAT 1/2 decision menu error		
0112	N/A	Correct "UNKNOWN NAME" cases when calling name sent in PRI facility message		
0113	N/A	Fix intermittent timer degradation		
0114	N/A	Correction of TGN traffic report incoming talk average calculation		
0115	N/A	Fix PRI L3 protocol error (Cause 96) due to improper disconnect sequence		
0116	N/A	Fix error restart when automatic callback is interrupted by new call		
0117	N/A	Quiet the squeal on some T1 connections / transfers		
0118	N/A	Fix "UNKNOWN NAME" on CAP 2 call when calling name is sent in PRI FAC message		
0119	N/A	Fix intermittent failure when backing up floppies (part 2)		
0120	N/A	Fix L3 protocol error caused by double connect of ACD greeting		
0121	N/A	Fix VMS lockup when invalid PRI facility message is sent from CO		
0122	N/A	Correct DID error checking on station cancellation		
0123	N/A	Correct operation of wakeup terminating to unplugged SelecSet		
0124	N/A	Prevent system crash after direct trunk access switch hook flash		

Note 1: This update uses an overlay area which may cause the system to become unstable when some CMAT screens are accessed prior to reload.

Note 2: This update modifies the customer data area. RCD must not be performed after this patch is applied until the system is reloaded.

Note 3: This update was determined to be deficient after it was released. Please check for a later update to supplement this one.